Shipment Handling Instruction

BIO-CEL® L-2 DOUBLE (SS316) / XL-2 (SS316) PART NUMBER: 1000026143 (10000226145) / 1000003053 (1000026161)

The following are recommendations for safe storage and transport of BIO-CEL* MBR modules prior to installation. The second part covers transport and handling on site by forklift and crane. Please make sure that the required materials are available on site.


For questions or additional information, please contact MANN+HUMMEL WFS Technical Service.

Caution: Transport with complete packaging only.

- Keep module in original packaging for further storage and transportation purposes and to move module to location of installation.
- Leave module on pallet until beginning of installation.

SAFETY INSTRUCTIONS - LISTED ON PACKAGING

To transport and temporarily store the module before installation, please consider the safety instructions listed below. These instructions are also listed on the packaging.

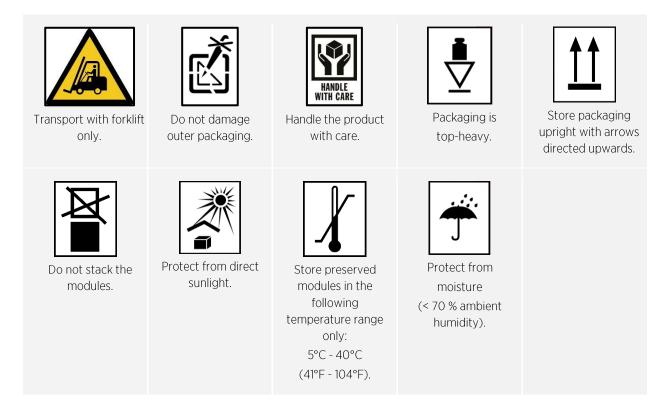



SAFETY PRECAUTIONS

Please consider local safety requirements.

TRANSPORTATION BY FORKLIFT

To move the module, please consider the below instructions and use appropriate safety equipment during transportation. More detailed information about the dimensions of the module can be found in the Scope of Supply Sheet: "TDS-WW028_ BIO-CEL L-2 Double Scope of supply-Accessories-Spare parts".

Choose a suitable forklift to transport the module:


- Maximum dimension (H/W/L) including packaging:
 2580 x 1650 x 2338mm (8.5 x 5.4 x 7.7 ft)
- Weight of product: 1000 kg (2200 lbs)
- Floor load (module)
 284 kg/m² (58 psf)
- Required depth of fork:2000 mm (6.6 ft)

Caution: Danger of tipping over

The module is top-heavy; incorrect handling may result in tipping over.

For correct positioning of the forks, you will find mass focus signs on the packaging.



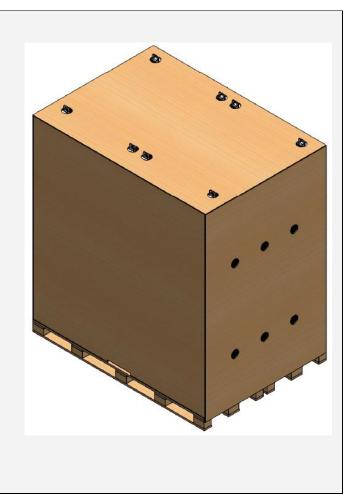



UNPACKING & INSTALLATION

Please read the BIO-CEL® MBR Operation and Maintenance Manual before unpacking and installing the module; the manual explains each installation step in full detail.

The assembly instructions for optional accessories are supplied directly with the accessory parts or can be requested from MANN+HUMMEL WFS Technical Service.

TRANSPORTATION BY CRANE

- A crane may be used to lift the completed modules to a desired location.
- The module must be lifted with a special traverse.
 For lifting chains it must be ensured that chains has a minimum length of 3,2 meters.
- Avoid sliding the module across the floor during the transportation process. Lift the module completely off the ground.
- Max weight for lifting is 1500 kg (3307 lbs).

In the case that the module must be transported and installed using a crane, please read the relevant chapters (1.7 and 6) in the BIO-CEL* MBR Operation and Maintenance Manual beforehand. This chapter includes information on how to fix the supplied lifting eyes correctly and how to transport the module safely with a crane.



Europe

Germany: +49 611 962 6001 Italy: +39 0721 1796201 info.wfs@mann-hummel.com

Americas

USA: +1805 964 8003 sales.mnus@microdyn-nadir.com

Asia

APAC: +65 6457 7533 info.wfs@mann-hummel.com China: +86 10 8413 9860 waterchina@mann-hummel.com

