

PERGO®


ACCESSORIES
Repair Kit
English



Repair Kit

General information

With this kit you can easily repair light damage and recreate the original colour of your floor. By blending the different wax colours together it is possible to perfectly copy the design of the damaged floor.

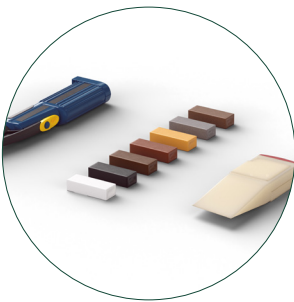

CONTENTS	COMPOSITION	COLOUR
Melting knife	Plastic, rubber, steel, stainless steel, brass nickel plated	Blue
7 wax blocks	Paraffin	7 different colours
Cleaning comb	Plastic	Red
Special fillers applicator	Plastic	White
Sanding pad	Wooden fleece	Grey
Polishing pad	Microfibre/fleece	Green/white

TECHNICAL DATA SHEET - EDITION 08.2025

Repair Kit

ORDER CODE

DIMENSIONS

PGREPAIR

290 x 125 x 28 mm

Applicable for:

Repairing light damage of all Pergo floors.

Repair Kit

Features

Don't let light damage get you down. The Pergo Repair kit offers the best tools to to easily repair light damage and renew the original colour of your floor caused by, for example, scissors.

- **Colour chart available for a perfect match with each Pergo floor**

Check out the colour table to find out exactly which wax colours you need to mix to match your Pergo floor (see pergo.com).

Repair Kit

Preparation



1. Make sure the melter is equipped with 3 AA 1.5 batteries.
2. The area to be repaired has to be clean, dry and free from grease. If necessary, remove any loose or protruding particles with a pointed item.
3. Choose colours according to the indications in the colour chart (see pergo.com). Begin with the 'starter colour' and mix in further (usually darker) colours. The colours between brackets () are not always necessary, depending on the surface area. Notice that they change the colour so much that you only need a very small amount of them. For the grains, use a little more or even only the darker colours between brackets.

Repair Kit

Installation



1. Activate the melter by removing the protective cap, sliding the yellow button to 'ON' and pressing the blue button (10 to 15 seconds). Ensure that the tip is fitted correctly. A red light indicates that the melter is heating up. Melt off small portions of the colour sticks and mix together. If the wax blocks start smoking during melting, release the "ON" button. Do not touch the tip during operation. The melter has a heat capacity of 30 minutes when operated permanently. However it is recommended to work at shorter intervals and to switch off tool from time to time.
2. Let wax mixture flow into the damaged area. Always slightly overfill the area! For more information, consult the instruction video on quickstep.com.
3. Use the sharp grooves of the special fillers applicator to strip off excess material.
4. For precise adjustment, restore the grain pattern of the filled area by slightly scratching with a pointed item and re-fill with a darker colour. Level off excess material with the planer grooves of the special fillers applicator.
5. Use the grey sanding pad to degrease the area. The gloss level of the mixture becomes matt.

TECHNICAL DATA SHEET - EDITION 08.2025

Repair Kit

6. The gloss level can be adjusted with the green/white polishing pad. The green side of the cloth polishes while the white side reduces the gloss level.
7. Always store the melter with the cap fitted and ensure ON/OFF switch is set to OFF position. Do not forget to replace the cap when the melter is no longer needed. Make sure the tip has cooled down before storage. Never bring the tool into contact with water.

Unilin bv division flooring
Ooigemstraat 3, B-8710 Wielsbeke
T: +32 56 67 52 11
unilin.com
pergo.com

 **UNILIN**

PERGO®